

# ROQ

# FIT

## SMALL & FAST

### ROQ Fit MAIN HIGHLIGHTS



max. production  
**1000\* pieces/hour**




max. printing area  
**400x500mm**



suits best for  
**M print sizes**

\* indicative value, which may vary depending on the size of the print. For more information, see the data table.

### PALLETS, SCREEN AND PRINT SIZES

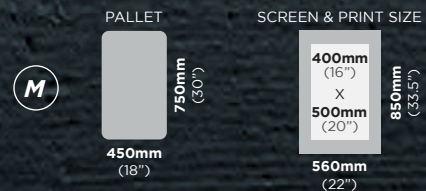

INDEX PRECISION: +/- 0.025mm / 0.001"

MAX. FRAME PROFILE/THICKNESS: 50x50mm / 2"x2"

ROQ Fit	P08
number of colors (max.)	4
number of pallets	8
nr of flash cure connection units (optional)	3
maximum production (pieces/h) *	1000
compr. air consumption (l/min. 7 bar) **	250l/min - 8,9 cfm + number of printhead
maximum consumption (kVA) ***	2
machine diameter (mm/feet)	3430 / 11,3'
total height (mm/feet)	2316 / 7,72'
minimum width of the base (mm/feet)	790 / 2,6'
machine weight (kg/lbs)	800 / 1764

\* on squeegee with flooding for an A4 print size.

\*\* consumption of each printhead; on squeegee with flooding for an A4 print size.

\*\*\* these values exclude the consumption with flash curing, they should be calculated separately, taking into account the number of flash cure employed on the machine.

- power supply: 230V+N, 2x230V, 3x230V, 3x400V+N in 50Hz or 60Hz.

